JSA Number: JSA-11

Task: Surface Soil Sampling

JSA NUMBER: Yerington – 11	<b>DATE:</b> 10/15/04	Company Performing the Job:	SUPERVISOR: Penny Bassett, Brian Bass
NEW X		Brown and Caldwell	
REVISION			SAFETY OFFICER: Brian Bass
JOB TITLE OR TASK:		TITLE OF PERSON(S) WHO PERFORMS JOB:	ANALYSIS BY: Penny Bassett
		Site Managers: Penny Bassett, Brian Bass	REVIEWED BY:
Surface Soil Sampling		Site Technicians or Engineers: Raymond Lauster, Tina	APPROVED BY:
		Cox, Raquel Kutsch	

**RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT (PPE) AND/OR PERTINENT JOB SAFETY FORMS:** Hard hat, safety goggles or glasses, steel-toed boots. As appropriate: rubber gloves, face shield, rubber boots or hip waders, half-mask respirator.

SEQUENCE OF BASIC JOB STEPS	POTENTIAL HAZARDS	PREVENTIVE OR CORRECTIVE ACTION
1. Pre-Construction Safety Meeting.		1. All employees assigned to this task will attend a pre-construction safety meeting, which will include the pertinent JSAs, Standard Operating Procedures, types of potential hazards, and actual hazards present and controls for those hazards.
2. Prepare sample bottles and dress in appropriate PPE.	Burn or corrosion from acid spillage, if sample bottles do not have acid already in them.	Wear protective gloves and safety glasses or goggles when transferring acid from storage container to sample containers.  Ensure that gloves are appropriate for acids.
3. Sample collection	1. Physical injury from hand tools (pick, shovel, hand auger)	1. Stand clear of person wielding digging pick or shovel. Use proper technique to avoid back strain. Wear leather gloves when using hands for activities other than sampling. Wear hard hat and steel-toed boots at all times.
	2. Inhalation of dirt or dust during work activities.	2. To avoid inhalation of dust, wear a fit-tested half-face respirator with appropriate cartridges for particles and other potential contaminants, including radionuclides. The respirator must be worn whenever field instruments indicate the need, or whenever wind-blown dust is obvious, in combination with detected
	Inhalation or dermal contact of dirt or dust after work activities	contaminants.  3. Wear rubber or latex gloves to prevent contact with hands and arms. To avoid inhalation or dermal contact from dirt and dust that can accumulate on clothing, wear coveralls or suits (e.g., tyvek suits) that protect regular work clothes, boots, and hair from exposure to dust and dirt. Remove work clothes, including
	4. Exposure to radiation hazards	<ul> <li>boots, before entering environments outside of the work site such as your home.</li> <li>4. Some areas where sampling occurs may have low-level (alpha) and/or high-level (gamma) radiation hazards. Monitor each drill location for radiation before setting up. Areas with alpha radiation &gt;200 CPM or gamma &gt;200 uR/hr require use of respirator, &gt;500 CPM or gamma &gt;500 uR/hr requires respirator, goggles, tyvek suit and rubber boots.</li> </ul>
4. All Activities	Back, hand, or foot injuries during manual handling of materials.	Workers should inspect materials for slivers, jagged or sharp edges, and rough or slippery surfaces.     Workers should wipe off greasy, wet, slippery, or dirty objects

JSA Number: JSA-11

Task: Surface Soil Sampling

		<ol> <li>before attempting to handle them.</li> <li>In most cases, gloves or other protection should be used to prevent hand injuries.</li> <li>Steel-toed boots should be used for protection of the feet when not in the water.</li> <li>Routes should be surveyed for obstacles prior to moving materials from one location to another.</li> <li>All three main factors in manual lifting (load location, task repetition, and load weight) must be considered when evaluating what is safe or unsafe to lift.</li> <li>All manual handling of heavy or bulky objects should be carefully planned to avoid injuries and damage to equipment.</li> </ol>
5. All Activities	1. Heat exhaustion or stroke.	<ol> <li>Avoid strenuous work in ambient temperatures over 80 degrees F.</li> <li>Wear light-colored clothing, shaded sunglasses, and hat that provides shade and adequate air movement.</li> <li>Find cool, shady area for breaks or respite from heat.</li> <li>If worker feels dizzy, has a headache, has cool, moist, or pale skin or is weak, immediately move to a cooler environment, loosen tight clothing, provide air circulation to area, and provide small amounts of cool water to drink.</li> <li>If worker has a change in level of consciousness, high body temperature, red, hot skin, rapid or weak pulse, or rapid or shallow breathing, call the emergency phone number and give care in accordance with #4 above.</li> </ol>
5. All Activities	1. Hypothermia or frostbite.	<ol> <li>Avoid working in extreme cold.</li> <li>Wear warm, layered clothing with adequate protection for hands and feet.</li> <li>Find warm area out of the wind for breaks or respite from cold.</li> <li>If worker experiences shivering, irregular pulse, numbness, glassy stare, impaired judgement, loss of muscle control with no shivering, or loss of consciousness, gently move worker to warm place, check vital signs, remove any wet clothing, cover with blankets and warm slowly.</li> <li>If worker experiences loss of feeling or sensation in extremities, discolored or waxy skin, blisters or blue skin, remove wet clothing and jewelry, soak frostbitten area in warm water, cover with dry, sterile dressing (do not rub anything on the area), check vital signs.</li> </ol>
6. Unsafe conditions.	1. All potential hazards.	Where a situation presents a hazardous condition, the exposed employee will be removed from the hazardous area until all necessary precautions have been taken to eliminate the hazard and ensure their safety.

JSA Number: JSA-11

Task: Surface Soil Sampling

**Personnel Signatures** JSA NUMBER: Yerington – 11 **Company Performing the Job: DATE:** 10/15/04 **SUPERVISOR:** Penny Basset, Brian Bass Brown and Caldwell NEW X REVISION **SAFETY OFFICER:** Brian Bass TITLE OF PERSON(S) WHO PERFORMS JOB: ANALYSIS BY: Penny Bassett JOB TITLE OR TASK: Site Managers: Penny Bassett, Brian Bass **REVIEWED BY:** Site Technicians or Engineers: Raymond Lauster, Tina APPROVED BY: Surface Soil Sampling Cox, Raquel Kutsch